

VOR/DME or TACAN RWY 28

VORTAC SYA 109.0 Chan 27	APCH CRS 280°	Rwy ldg 10,004 TDZE 88 Arpt Elev 98
--------------------------------	------------------	---


AL-1246 [USAF]

EARECKSON AS (PASY)

* When ALS inop, increase CAT AB vis to 1 mile, CAT CDE vis to 1½ miles ** Circling Not Authorized in area N of Rwy 10-28.	SALS 	MISSED APPROACH: Climbing left turn to 3000, intercept SYA R-100 direct GICHY and hold.
--	----------	--

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 352.05
---------------------------------	----------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

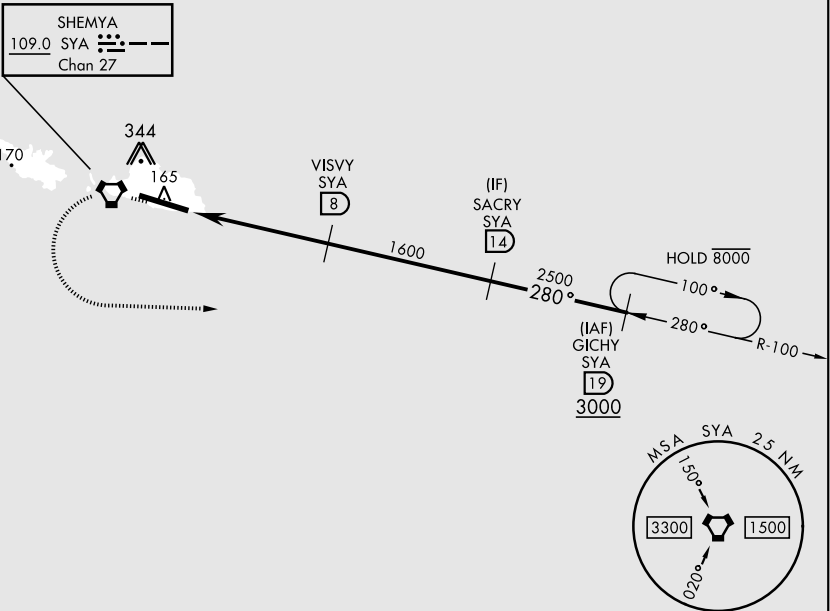

EMERG SAFE ALT 100 NM 5400

				ELEV 98	TDZE 88
FORCS 3	4.6	2.63°	TCH 46		
0.3	5 NM				
CATEGORY	A	B	C	D	E
S-28 *	620-1 532 (600-1)		620-1½ 532 (600-1½)		
CIRCLING **	620-1 522 (600-1)		620-1½ 522 (600-1½)	660-2 582 (600-2)	680-2 582 (600-2)
					HIRL Rwy 10-28 REIL Rwy 10 and 28

VOR/DME or TACAN RWY 28