

TAMPA, FLORIDA

AL-416 (FAA)



23222

LOC/DME F-MP 108.9 Chan 26	APP CRS 007°	Rwy Idg 10800 TDZE 11 Apt Elev 26
--	------------------------	--

ILS RWY 1L (SA CAT I)
TAMPA INTL (TPA)


⚠ Simultaneous approach authorized. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.	ALSIF-2 	MISSED APPROACH: Climb to 500 then climbing left turn to 3000 direct PIE VORTAC and hold, continue climb-in-hold to 3000 (TACAN aircraft climb to 500 then climbing left turn to 4000 direct PIE VORTAC then on PIE VORTAC R-276 to LAFAL/PIE R DME and hold W, RT, 096 inbound)
--	---	--

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307,175	119.5 269.4	121.7 269.4	133.6	

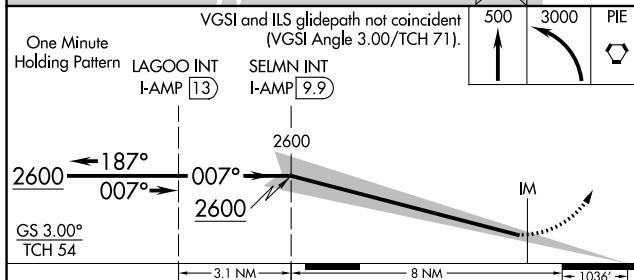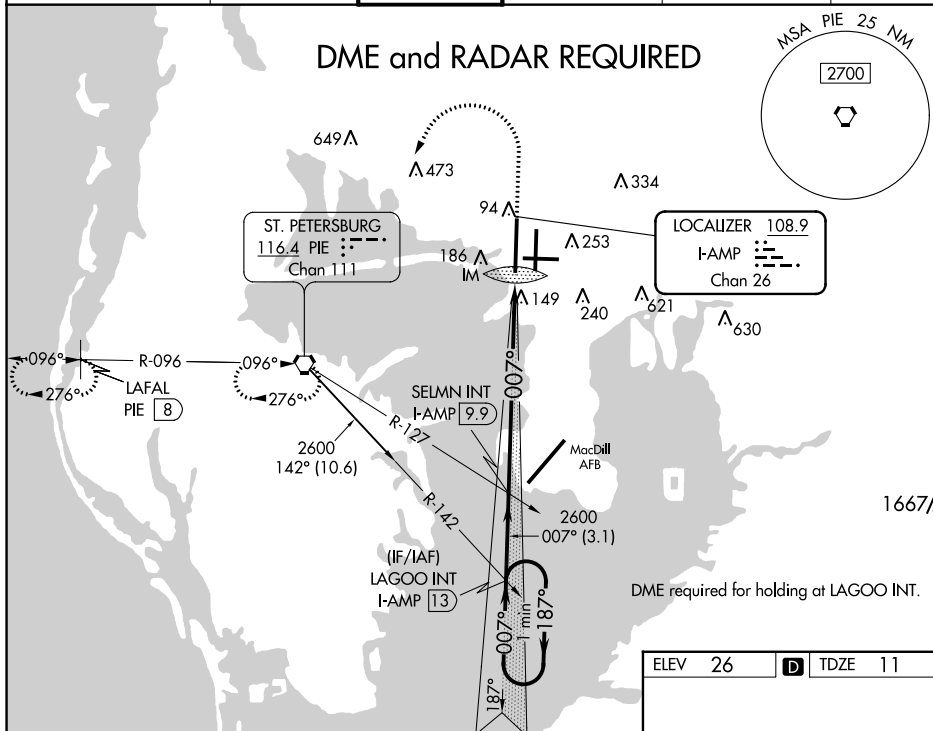

CATEGORY	A	B	C	D
S-ILS 1L	RA 155/14 150 DA 161			

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

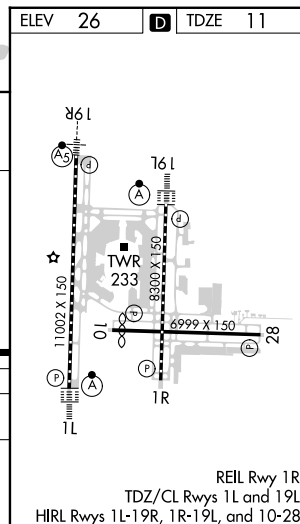

TAMPA, FLORIDA
Amdt 18 05JAN17

27°59'N-82°32'W

TAMPA INTL (TPA)
ILS RWY 1L (SA CAT I)

SE-3, 22 FEB 2024 to 21 MAR 2024