

COLUMBUS, OHIO

AL-6846 (FAA)



23054

LOC/DME I-DDV	APP CRS	Rwy Idg	12103
110.1	052°	TDZE	736
Chan 38		Apt Elev	744


ILS RWY 5R (CAT II)
RICKENBACKER INTL (LCK)

ADF or DME required.	ALS-F-2	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
NA	A	

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8
----------------	---------------------------------	----------------------------	--------------------------	---------------------------

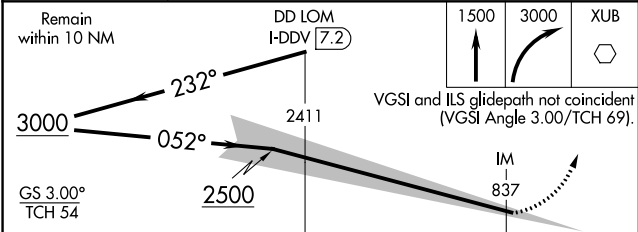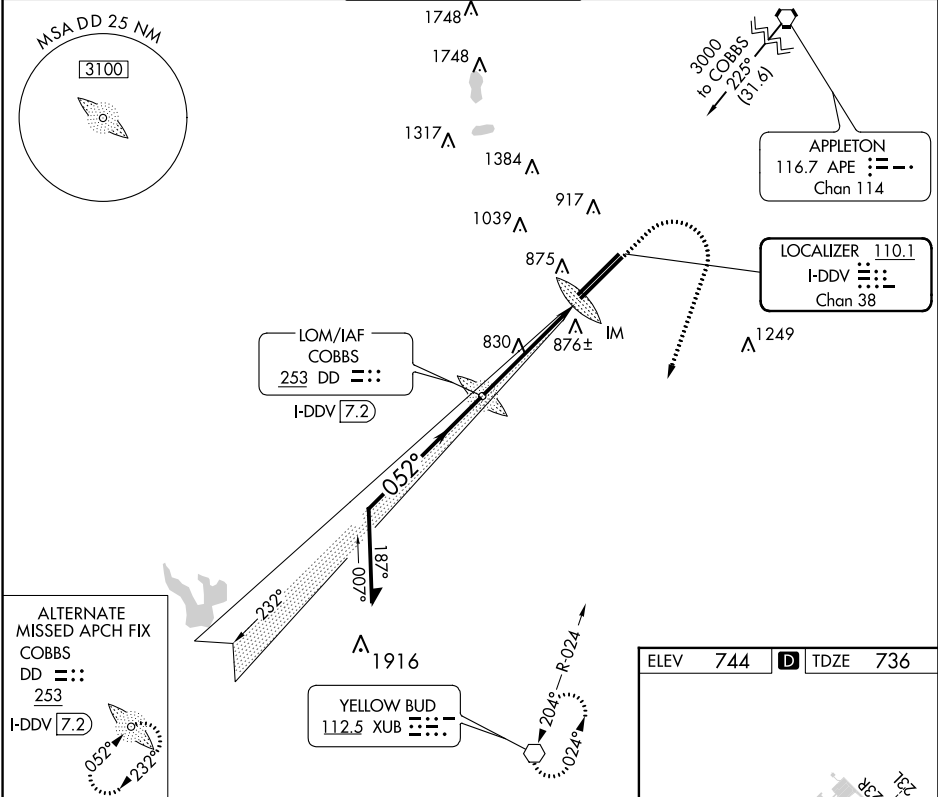

CATEGORY	A	B	C	D
S-ILS 5R	RA 100/12	100	DA 836	
CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED				

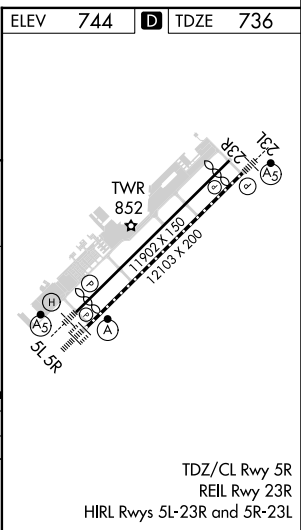

COLUMBUS, OHIO
Amdt 3E 09SEP21

39°49'N-82°56'W

RICKENBACKER INTL (LCK)
ILS RWY 5R (CAT II)

EC-2, 22 FEB 2024 to 21 MAR 2024

EC-2, 22 FEB 2024 to 21 MAR 2024