
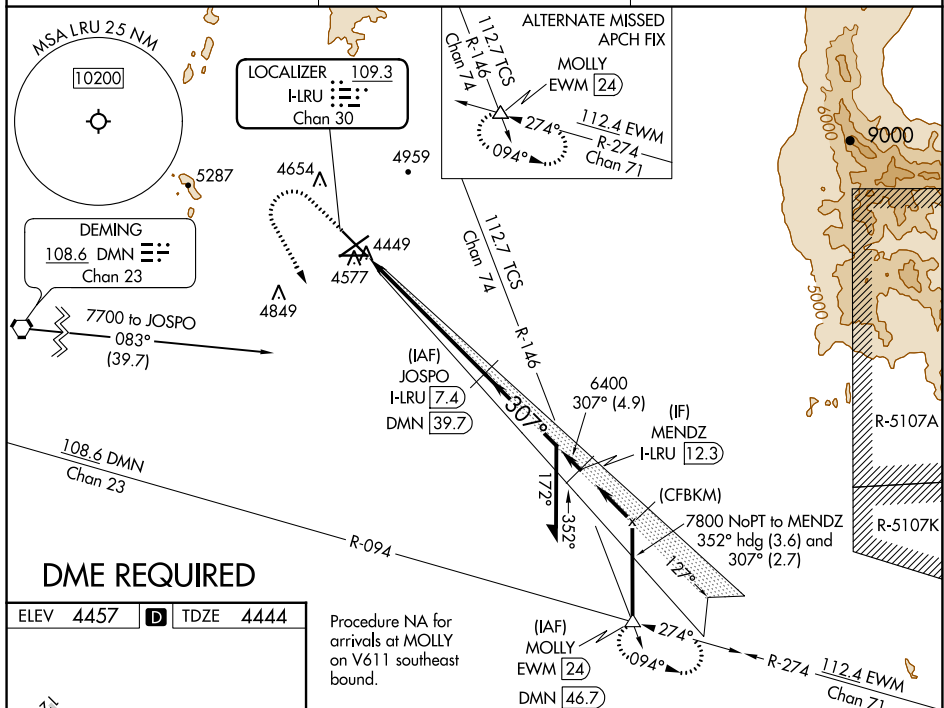


ILS or LOC RWY 30
LAS CRUCES INTL(LRU)

MISSED APPROACH: Climb to 5100 then climbing left turn to 9000 on heading 139° and on DMN VORTAC R-094 to MOLLY INT/DMN 46.7 DME and hold, continue climb-in-hold to 9000.

UNICOM
122.7 (CTAF) **L**

Procedure NA for arrivals at MOLLY on V611 southeast bound.

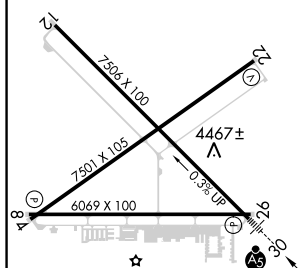

5100 ↑	9000 hdg 139°	DMN R-094	MOLLY △	JOSPO I-LRU 7.4	Remain within 10 NM
*LOC only.				6400	127°
*I-LRU 2.2				6400	307°
I-LRU 1.4				6400	GS 3.00° TCH 47
-0.7 NM				5.3 NM	
CATEGORY	A	B	C	D	
S-ILS 30	4644-1½ 200 (200-½)				
S-LOC 30	4720-½ 276 (300-½)				
C CIRCLING	4900-1 443 (500-1)	5040-1 583 (600-1)	5320-2½ 863 (900-2½)	5320-2¾ 863 (900-2¾)	

SW-1, 22 FEB 2024 to 21 MAR 2024