
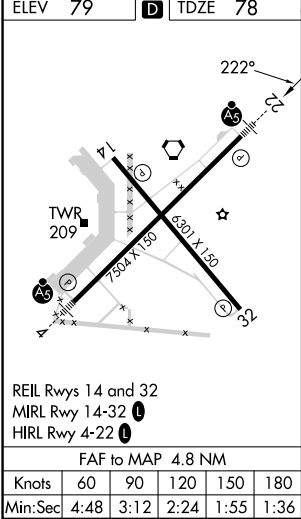


LOC I-MZR 109.5	APP CRS 222°	Rwy Idg 7504 TDZE 78 Apt Elev 79
---------------------------	------------------------	---

ILS or LOC RWY 22
MONROE RGNL (MLU)

DME or RADAR required for procedure entry.		MALSRL 	MISSED APPROACH: Climb to 1800 then climbing right turn to 3000 direct MLU VORTAC and hold, continue climb-in-hold to 3000.
Circling Rwy 14 NA at night. For inop ALS, increase S-LOC 22 Cat C/D visibility to 1½ SM. # DME from MLU VORTAC.			

ATIS 125.05	MONROE APP CON ★ 118.15 290.475	MONROE TOWER ★ 118.9 (CTAF) 257.8	GND CON 121.9	CLNC DEL 121.65	UNICOM 122.95
-----------------------	---	---	-------------------------	---------------------------	-------------------------

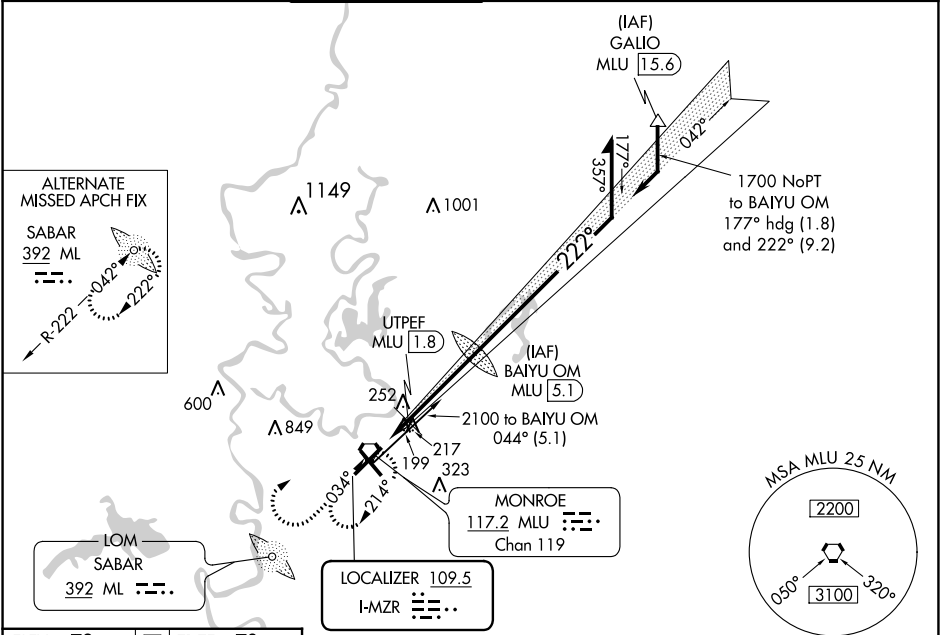

1800 ↑		3000 ↗		MLU 		VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 50).							
*LOC only.						BAIYU OM MLU 5.1		Remain within 10 NM					
UTPEF MLU 1.8						1675		042°		2100		GS 3.00° TCH 54	
CATEGORY		A		B		C		D					
S-ILS 22				278-½		200 (200-½)							
S-LOC 22		560-½		482 (500-½)		560-1		482 (500-1)					
CIRCLING		580-1		501 (600-1)		740-¾ 661 (700-¾)		1160-3 1081 (1100-3)					
# UTPEF FIX MINIMUMS													
S-LOC 22		500-½		422 (500-½)		500-¾		422 (500-¾)					
CIRCLING		580-1		501 (600-1)		740-¾ 661 (700-¾)		1160-3 1081 (1100-3)					