

WAAS CH 99641 W34A	APP CRS 335°	Rwy Idg 3300 TDZE 386 Apt Elev 386
--	------------------------	---


RNAV (GPS) RWY 34

REEDLEY MUNI (032)


NA For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). Circling NA east of Rwy 16-34. Baro-VNAV and VDP NA when using Fresno Yosemite Intl altimeter setting. Rwy 34 helicopter visibility reduction below ¾ SM NA. DME/DME RNP 0.3 NA. When local altimeter setting not received, use Fresno Yosemite Intl altimeter setting: increase all DAs 41 feet and all visibilities ½ SM; increase all MDAs 60 feet.

MISSED APPROACH: Climb to 860 then climbing left turn to 3100 direct DEICE and hold, continue climb-in-hold to 3100.

AWOS-3PT 120.175	FRESNO APP CON 132.35 323.25	UNICOM 122.7 (CTAF) ①
----------------------------	--	---------------------------------

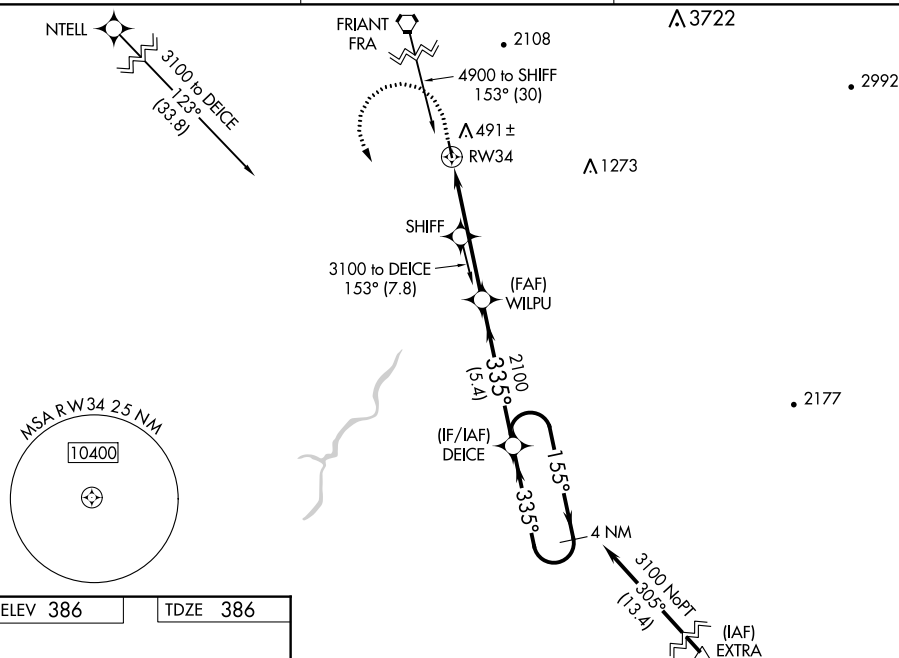

ELEV 386		TDZE 386
----------	--	----------

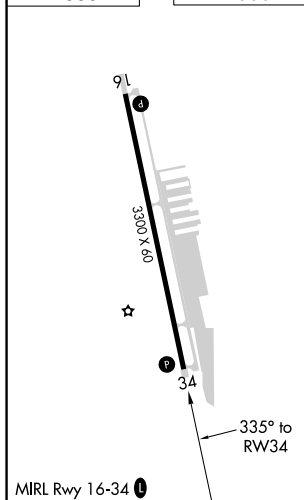

VGS1 and RNAV glidepath not coincident (VGS1 Angle 4.00/TCH 49).

860 3100 DEICE

4 NM Holding Pattern

WILPU 2100

DEICE

155° 3100

335°

2100

GP 3.00° TCH 49

1 NM 4.2 NM 5.4 NM

RW34

* 1 NM to RW34

* LNAV only