


TACAN RWY 34

|                                                                                                                                  |               |                                       |               |                                                                                                                                                                                                    |
|----------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------------------|---------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| TACAN TCM Chan 33                                                                                                                | APCH CRS 347° | Rwy ldg 10,108 TDZE 322 Arpt Elev 322 | AL-414 [USAF] | MCCHORD FLD (KTCM)                                                                                                                                                                                 |
| * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CD vis to 1½ miles.<br>** Circling not authorized E of Rwy 16-34. |               |                                       | ALSF-2        | MISSED APPROACH: Climb to 4000 on TCM TACAN R-345 to OYABO, then turn left via 215° course to intercept TCM R-267 to CUBIT and hold. Cross OYABO at or above 3000. Continue climb-in-hold to 4000. |

|                    |                              |                   |                        |
|--------------------|------------------------------|-------------------|------------------------|
| ATIS 135.825 270.1 | SEATTLE APP CON 126.5 377.15 | TOWER 124.8 259.3 | GND CON 118.175 279.65 |
|--------------------|------------------------------|-------------------|------------------------|

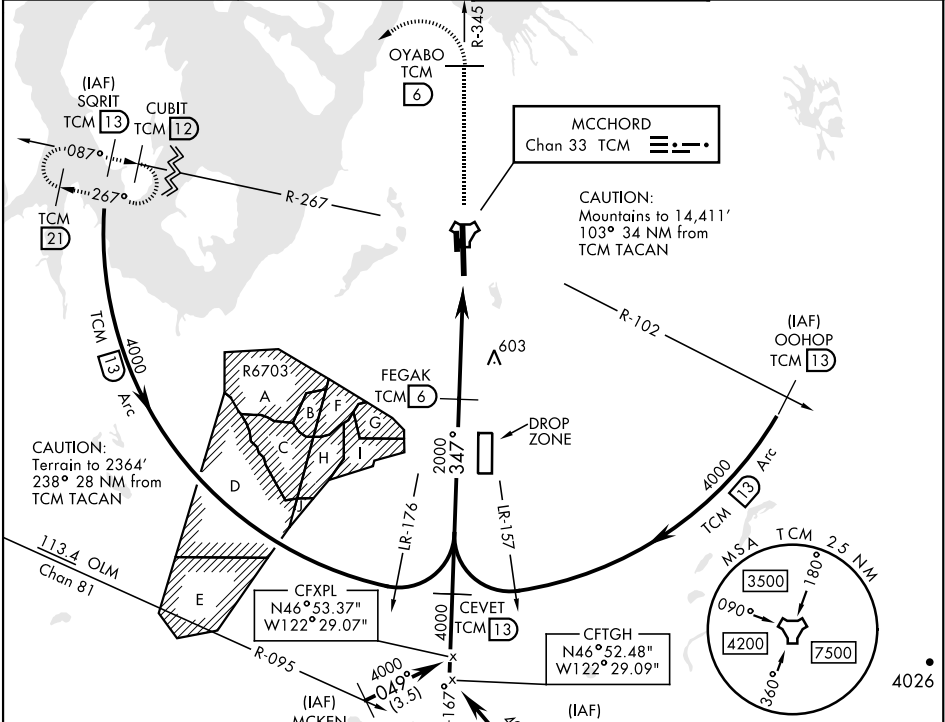

|                   |  |                                                          |  |
|-------------------|--|----------------------------------------------------------|--|
| ELEV 322          |  | TDZE 322                                                 |  |
| 4000 TCM R-345    |  | VGSI and descent angles not coincident (VGSI Angle 3.00) |  |
| OYABO 6           |  | CEVET 13                                                 |  |
| crs 215°          |  | R-267                                                    |  |
| TACAN             |  | FEGAK 6                                                  |  |
| EDEBE 1.9         |  | 4000                                                     |  |
| 0.5               |  | 4.1 NM                                                   |  |
| CATEGORY          |  | TCH 59                                                   |  |
| A                 |  | 3.34°                                                    |  |
| B                 |  | TCH 59                                                   |  |
| C                 |  | 860/24 538 (600-½)                                       |  |
| D                 |  | 860/55 538 (600-1)                                       |  |
| S-34*             |  | 940-1 618 (700-1)                                        |  |
| 940-1 618 (700-1) |  | 940-2 618 (700-2)                                        |  |
| CIRCLING**        |  | HIRL Rwy 16-34 TDZL/CL Rwy 34                            |  |

TACAN RWY 34

NW-1, 22 FEB 2024 to 21 MAR 2024

NW-1, 22 FEB 2024 to 21 MAR 2024