

TAMPA, FLORIDA

AL-416 (FAA)

23222

WAAS CH 50406 W01A	APP CRS 007°	Rwy Idg 10800 TDZE 11 Apt Elev 26
--	------------------------	--

RNAV (GPS) RWY 1L
TAMPA INTL (TPA)


▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -1.5°C (5°F) or above 43°C (109°F). DME/DME RNP-0.3 NA. For inop ALSF, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to 1½ mile, and LNAV Cat E visibility to RVR 6000. Simultaneous approach authorized with Rwy 1R. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations.

ALSF-2




MISSED APPROACH:
Climb to 3000 direct
MERRA and hold.


ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307.175	119.5 269.4	121.7 269.4	133.6	

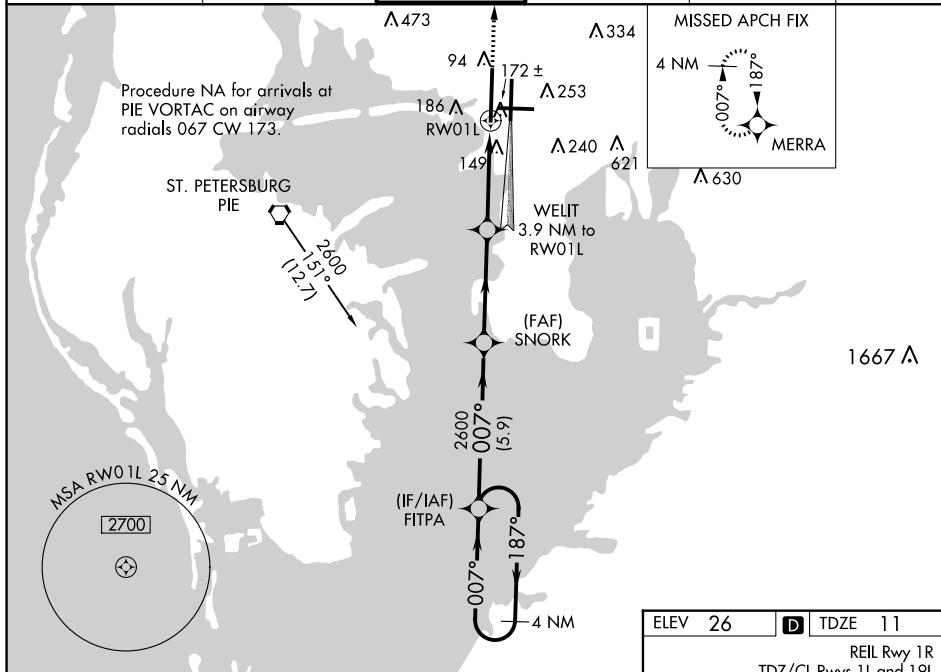

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).

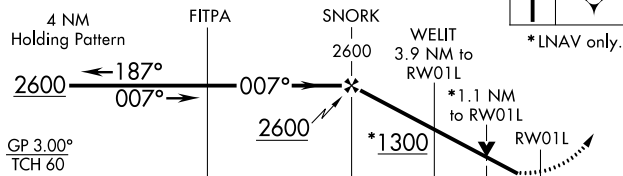

		← 5.9 NM →		← 4 NM →		← 2.8 →		← 1.1 NM →	
CATEGORY	A	B		C		D		E	
LPV DA	211/18		200 (200-½)						
RNAV/ VNAV DA	431/45		420 (500-¾)						
RNAV MDA	440/24 429 (500-½)		440/40		429 (500-¾)				
 CIRCLING	560-1 534 (600-1)		680-1¾ 654 (700-1¾)		980-3 954 (1000-3)				

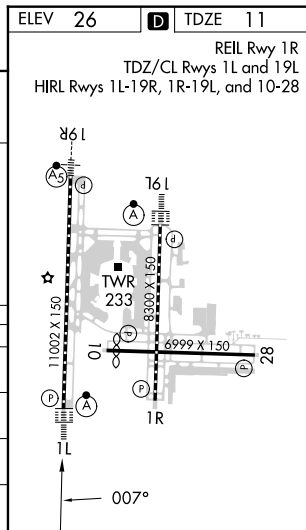

TAMPA, FLORIDA
Amdt 2D 08OCT20

27°59'N-82°32'W

TAMPA INTL (TPA)
RNAV (GPS) RWY 1L

SE-3, 22 FEB 2024 to 21 MAR 2024